



Larmos Autoservices

Technician: Andreas Larmou

Date: 20/10/2025

Customer Name: Car Addicts Cyprus

Yr/Make/Model: 1998 Nissan Patrol GR TD-6

VIN:

Mileage: 81300

Repair Order #

BRAKE AND TIRE

Left Front

☒	☒	Brake Lining	_____ mm
☒	☒	Tire Tread	12mm 32nds
☒	☒	Wear Pattern	Even
		Tire Pressure PSI	Before: 27 After: 32

Right Front

☒	☒	Brake Lining	_____ mm
☒	☒	Tire Tread	12mm 32nds
☒	☒	Wear Pattern	Even
		Tire Pressure PSI	Before: 28 After: 32

☒ ☒ Rotor / Drum

☐ Alignment Check Needed



☒ ☒ Rotor / Drum

☐ Wheel Balance Needed

Left Rear

☒	☒	Brake Lining	_____ mm
☒	☒	Tire Tread	8mm 32nds
☒	☒	Wear Pattern	Even
		Tire Pressure PSI	Before: 28 After: 32

Right Rear


☒	☒	Brake Lining	_____ mm
☒	☒	Tire Tread	8mm 32nds
☒	☒	Wear Pattern	Even
		Tire Pressure PSI	Before: 28 After: 32

☒ ☐ Rotor / Drum

☒ ☐ Rotor / Drum

☐ Brake Inspection Not Performed This Visit

PRIOR BODY DAMAGE

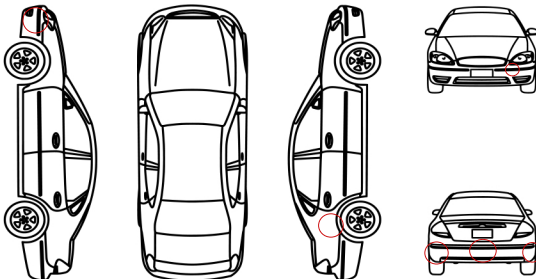

X
ADVISOR

X
CUSTOMER ACKNOWLEDGMENT

COMMENTS / ESTIMATES

Vibration from both front wheels under braking

Front Suspension Arm Bushes/Steering ball joints left/right

Thermostat and Radiator upper hose leak

Needs new wipers

CHECKED AND OKAY

MAY NEED FUTURE ATTENTION

REQUIRES IMMEDIATE ATTENTION

INTERIOR / EXTERIOR

☒	☐	☐	Head Lights, Tail Lights, Turn Signals, Brake Lights Hazard Lights, Exterior Lamps, License Plate Lights
☐	☒	☐	Windshield Washer/Wiper Operation, Wiper Blades
☒	☐	☐	Windshield Condition: Cracks / Chips / Pitting
☒	☐	☐	Mirrors / Glass
☒	☐	☐	Emergency Brake Adjustment
☒	☐	☐	Horn Operation
☒	☐	☐	Fuel Tank Cap Gasket
☐	☐	☐	Air Conditioning Filter (if equipped)
☒	☐	☐	Clutch Operation (if equipped)
☒	☐	☐	Back Up Lights Left / Right
☒	☐	☐	Dash Warning Lights
☒	☐	☐	Carpet / Upholstery / Floor Mats

UNDER VEHICLE

☒	☐	☐	Shock Absorbers / Suspension / Struts
☐	☒	☐	Steering Box, Linkage, Ball Joints, Dust Covers
☒	☐	☐	Muffler, Exhaust Pipes/Mounts, Catalytic Converter
☒	☐	☐	Engine Oil and Fluid Leaks
☒	☐	☐	Brakes Lines, Hoses, Parking Brake Cable
☒	☐	☐	Drive Shaft Boots, Constant Velocity Boots, U-Joints, Transmission Linkage (if equipped)
☒	☐	☐	Transmission, Differential, Transfer Case, (Check Fluid Level, Fluid Condition, and Fluid Leaks)
☒	☐	☐	Fluid Lines and Connections, Fluid Tank Band, Fuel Tank Vapor Vent Systems Hoses
☒	☐	☐	Inspect Nuts and Bolts on Body and Chassis

UNDER HOOD

☐	☒	☐	Fluid Levels: Oil, Coolant, Battery, Power Steering, Brake Fluid, Washer, Automatic Transmission
☒	☐	☐	Engine Air Filter
☒	☐	☐	Drive Belts (condition and adjustment)
☐	☒	☐	Cooling System Hoses, Heater Hoses, Air Condition, Hoses and Connections
☐	☒	☐	Radiator Core, Air Conditioner Condenser
☐	☒	☐	Coolant Recovery Reservoir Fluid Level / Condition
☒	☐	☐	Clutch Reservoir Fluid / Condition (as equipped)

BATTERY PERFORMANCE

☒	☐	☐	Battery Terminal / Cables / Mountings
☐	☒	☐	Condition of Battery / Cold Cranking Amps

BATTERY COLD CRANKING AMPS:

Factory Specs: 750CCA

Actual: 710CCA