



Larmos Autoservices

Technician: Andreas Larmou

Date: 05/02/2026

Customer Name: Car Addicts Cyprus


Yr/Make/Model: 2017 Hyundai ix35

VIN: TMAJU81ULFJ741985

Mileage: 141,700kms

ENGINE & COOLING SYSTEM

Oil & coolant levels and condition

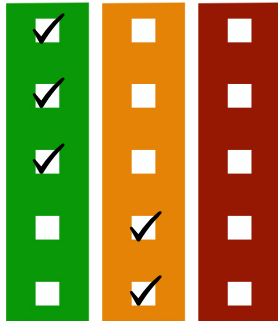

Engine noise / vibration / leaks

Cooling system hoses / radiator / fan

Belts & pulleys condition

ECU codes / exhaust smoke / idle quality

Comments: Drive Belt worn - will need replacement soon


Some Old Fault Codes still stored in the system

ELECTRICAL SYSTEM

Battery voltage / terminals / charging

Starter motor / alternator function

Lights & indicators / dashboard warnings

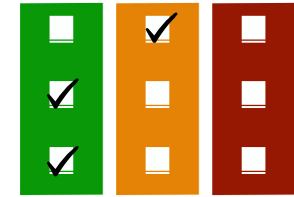

Comments: Will need new battery soon

AIR CONDITIONING & HVAC

Compressor / airflow / temperature

Heater function



Comments: Ok

DIAGNOSTIC SCAN

Fault codes retrieved

Systems check



Comments: No active Codes, only old fault codes - Report attached

EXHAUST SYSTEM

Visual condition / corrosion

Mouting brackets secure



Comments: Ok

SUSPENSION & STEERING

Front & rear suspension bushes		✓	
Ball joints / tie rods / rack condition	✓		
Shock absorbers / struts / bushes	✓		

Comments: Bush noise - rear left

Steering Wheel not centered - needs alignment

BRAKING SYSTEM

Brake pad / disc condition		✓	
Brake hoses / lines / leaks	✓		
Brake fluid level & color	✓		
Handbrake / ABS operation	✓		

Comments: Rear Brake Pads need replacement

TRANSMISSION, CLUTCH & DIFFERENTIAL


Gearshift operation / smoothness	✓		
Clutch pedal feel & bite point		✓	
Transmission fluid level / leaks	✓		
Differential operation / noises	✓		

Comments: Clutch feels heavy - bites good

WHEELS & TYRES

Tyre tread depth / brand matching			✓
Wear pattern	✓		
Wheel condition / cracks	✓		

Comments: New - Roadstone Eurovis HP02 225/60R17

Mechanic's Signature: 

Date: 05/02/2026

Disclaimer:

This Vehicle Inspection Report was produced for and paid for by Car Addicts Cyprus. The inspection reflects the vehicle's condition only at the time and date it was examined. All observations and findings are based on a visual and functional inspection carried out without dismantling any components, unless otherwise stated. While every effort has been made to ensure accuracy, Car Addicts Cyprus and the inspecting technician assume no responsibility or liability for any mechanical, electrical, or cosmetic issues that may arise after the date of inspection. This report does not constitute a warranty, guarantee, or valuation of the vehicle, and it should not be relied upon as the sole basis for a purchase decision.

Δήλωση Αποποίησης Ευθύνης:

Η παρούσα Έκθεση Ελέγχου Οχήματος εκπονήθηκε για λογαριασμό και με δαπάνη της Car Addicts Cyprus. Ο έλεγχος αντικατοπτρίζει την κατάσταση του οχήματος μόνο κατά την ημερομηνία και ώρα της επιθεώρησης. Όλες οι παρατηρήσεις και τα ευρήματα βασίζονται σε οπτικό και λειτουργικό έλεγχο, χωρίς αποσυναρμολόγηση εξαρτημάτων, εκτός εάν αναφέρεται διαφορετικά.

Παρά τη μέγιστη δυνατή προσοχή για την ακρίβεια των πληροφοριών, η Car Addicts Cyprus και ο τεχνικός που διενήργησε τον έλεγχο δεν φέρουν καμία ευθύνη ή υποχρέωση για μηχανικά, ηλεκτρικά ή αισθητικά προβλήματα που ενδέχεται να προκύψουν μετά την ημερομηνία του ελέγχου. Η παρούσα έκθεση δεν αποτελεί εγγύηση, διαβεβαίωση ή αποτίμηση της αξίας του οχήματος και δεν πρέπει να χρησιμοποιείται ως ο μοναδικός παράγοντας για λήψη απόφασης αγοράς.

2015 Hyundai(Europe) Vehicle Diagnostic Report

Vehicle Information

 2015/Hyundai(Europe)/ix35(EL)/D 1.7 TCI-U2
 VIN: TMAJU81ULFJ741985

 Odometer Reading: --
 License Plate: --

Customer Information

Name: --

Tel: --

Device information

 Scanner: MaxiSys Ultra
 Version: V9.00

 Serial Number: V1DGM4V01135
 Repair Order Number:
 V1DGM4V0113520260205103340061

System Scanned (12)

System	Status/DTC
ENG (Engine)	 0
ABS/ESP (Anti Lock Brake/Electronic Stability Program)	 0
AB (Airbag)	 1
TPMS (Tire Pressure Monitoring System)	 3
IMMO (Immobilizer)	 0
CODE (Transmitter Code Saving)	 0
A/C (Air Conditioner)	 0
EPS (Motor Driven Power Steering)	 0
BCM (Body Control)	 0
SPAS (Smart Parking Assist System)	 0
SMK (Smart Key Unit)	 0
SJB (Smart Junction Block)	 0

ADAS

DTC (4)

AB (Airbag) (1 DTC)

DTC	Description	Status
B1346	Driver airbag (DAB) resistance too high (1st Stage)	History

TPMS (Tire Pressure Monitoring System) (3 DTCs)

DTC	Description	Status
C1662	Auto learning failure	History

2015/Hyundai(Europe)/ix35(EL)/D 1.7 TCI-
U2

Test Time: 2026-02-05 10:34:40

Report ID: MAXIA20260205103440

C1314	Left rear sensor radio frequency channel failure/Sensor 3 radio frequency channel failure	History
-------	--	---------

C1613	CAN Signal error - Engine management system (EMS) (Check EMS)/CAN Transmission mismatch	History
-------	--	---------

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.