



Larmos Autoservices

Technician: Andreas Larmou

Date: 21/04/2026

Customer Name: Car Addicts Cyprus


Yr/Make/Model: 2011 Skoda Octavia 1.4L

VIN: TMBDJ21Z9B2097648

Mileage: 158,400km

ENGINE & COOLING SYSTEM

Oil & coolant levels and condition

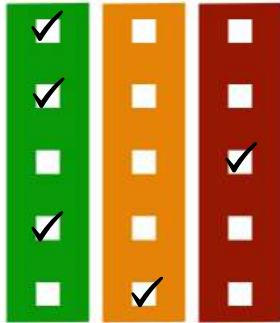

Engine noise / vibration / leaks

Cooling system hoses / radiator / fan

Belts & pulleys condition

ECU codes / exhaust smoke / idle quality


Comments: Water pump leaking

ELECTRICAL SYSTEM

Battery voltage / terminals / charging

Starter motor / alternator function

Lights & indicators / dashboard warnings

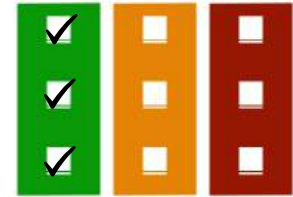

Comments: All Good

AIR CONDITIONING & HVAC

Compressor / airflow / temperature

Heater function



Comments: All Good

DIAGNOSTIC SCAN

Fault codes retrieved

Systems check



Comments: A few passive/Sporadic codes - Attached

Active codes for central locking actuator and lock (driver's door), but the central locking works fine

EXHAUST SYSTEM

Visual condition / corrosion


Mouting brackets secure




Comments: All Good

SUSPENSION & STEERING


Front & rear suspension bushes

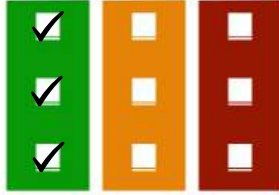

Ball joints / tie rods / rack condition

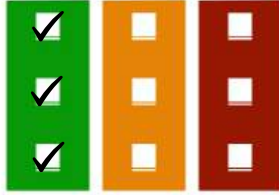


Shock absorbers / struts / bushes

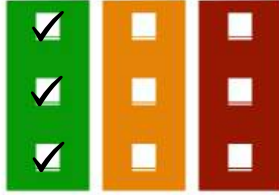


Comments: Lower engine mount bush needs replacement

BRAKING SYSTEM


Brake pad / disc condition

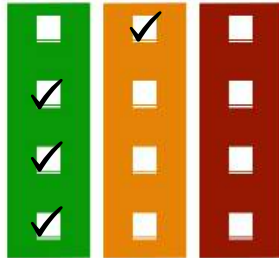


Brake hoses / lines / leaks

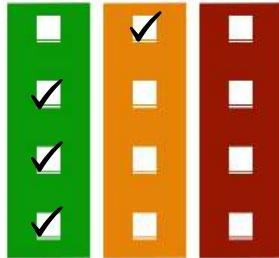

Brake fluid level & color

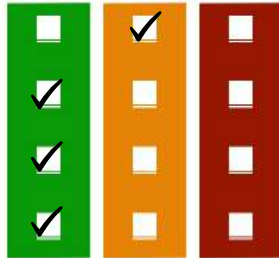

Handbrake / ABS operation

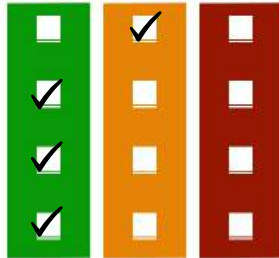


Comments: Front and rear brake disks will need replacement soon


Pads ok

TRANSMISSION, CLUTCH & DIFFERENTIAL


Gearshift operation / smoothness

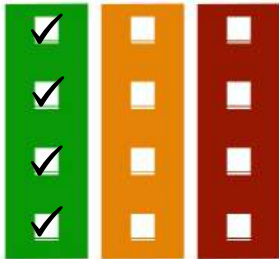


Clutch pedal feel & bite point

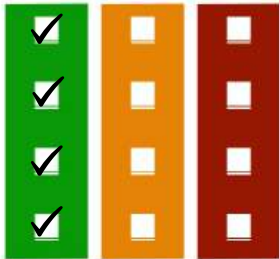

Transmission fluid level / leaks

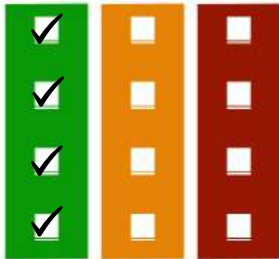

Differential operation / noises

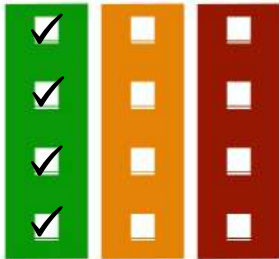

Comments: Gear selector knob is loose

WHEELS & TYRES

Tyre tread depth / brand matching



Wear pattern



Wheel condition / cracks



Comments: Davanti Tyres 205/55R16 - Production November of 2024

Tread depth ok

Mechanic's Signature: _____

Date: 21/04/2026

Disclaimer:

This Vehicle Inspection Report was produced for and paid for by Car Addicts Cyprus. The inspection reflects the vehicle's condition only at the time and date it was examined. All observations and findings are based on a visual and functional inspection carried out without dismantling any components, unless otherwise stated.

While every effort has been made to ensure accuracy, Car Addicts Cyprus and the inspecting technician assume no responsibility or liability for any mechanical, electrical, or cosmetic issues that may arise after the date of inspection. This report does not constitute a warranty, guarantee, or valuation of the vehicle, and it should not be relied upon as the sole basis for a purchase decision.

Δήλωση Αποποίησης Ευθύνης:

Η παρούσα Έκθεση Ελέγχου Οχήματος εκπονήθηκε για λογαριασμό και με δαπάνη της Car Addicts Cyprus. Ο έλεγχος αντικατοπτρίζει την κατάσταση του οχήματος μόνο κατά την ημερομηνία και ώρα της επιθεώρησης. Όλες οι παρατηρήσεις και τα ευρήματα βασίζονται σε οπτικό και λειτουργικό έλεγχο, χωρίς αποσυναρμολόγηση εξαρτημάτων, εκτός εάν αναφέρεται διαφορετικά.

Παρά τη μέγιστη δυνατή προσοχή για την ακρίβεια των πληροφοριών, η Car Addicts Cyprus και ο τεχνικός που διενήργησε τον έλεγχο δεν φέρουν καμία ευθύνη ή υποχρέωση για μηχανικά, ηλεκτρικά ή αισθητικά προβλήματα που ενδέχεται να προκύψουν μετά την ημερομηνία του ελέγχου. Η παρούσα έκθεση δεν αποτελεί εγγύηση, διαβεβαίωση ή αποτίμηση της αξίας του οχήματος και δεν πρέπει να χρησιμοποιείται ως ο μοναδικός παράγοντας για λήψη απόφασης αγοράς.

2011 (B) Skoda Vehicle Diagnostic Report

Vehicle Information

2011 (B)/Skoda/Octavia 2004 >/
VIN: TMBDJ21Z9B2097648

Odometer Reading: 158370 km
License Plate: --

Customer Information

Name: --















Tel: --

Device Information

Scanner: MaxiSys Ultra
Version: V13.50

Serial Number: V1DGM4V01135
Repair Order Number:
V1DGM4V0113520260421091640140

System Scanned (13)

System	Status/DTC
System	 0
01 - Engine Control Module 1	 0
03 - Brakes 1	 1
08 - Air conditioning	 1
09 - Electronic central electric	 1
15 - Airbag	 0
16 - Steering column electronics	 0
17 - Instrument cluster	 1
19 - Gateway	 0
25 - Immobilizer	 2
42 - Driver's door electronics	 0
44 - Power steering	 0
52 - Passenger's door electronics	 0
56 - Radio	 1

DTC (7)

08 - Air conditioning (1 DTC)

DTC	Description	Status
B109D71	Air distribution door servomotor Actuator stuck	Passive/Sporadic

09 - Electronic central electric (1 DTC)

DTC	Description	Status
-----	-------------	--------

00931:008	Lock unit for central locking Right Rear - Implausible signal	Passive/Sporadic
-----------	--	------------------

15 - Airbag (1 DTC)

DTC	Description	Status
00532:002	Supply voltage - Lower limit not reached	Passive/Sporadic

19 - Gateway (1 DTC)

DTC	Description	Status
00469:011	Infotainment data bus in single wire - Open circuit	Passive/Sporadic

42 - Driver's door electronics (2 DTCs)

DTC	Description	Status
00928:008	Lock unit for central locking Driver side - Implausible signal	Active/static
00105:008	Signal central locking SAVE/LOCK on driver side - Implausible signal	Active/static

56 - Radio (1 DTC)

DTC	Description	Status
00446:002	Function limitation due to insufficient voltage - Lower limit not reached	Passive/Sporadic

Technician Notes

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.